

Work Order ID 145353

Thursday, May 05, 2016 1:41:30 PM

145353

Page 1

Item ID: D119-796-241TRN

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Crosstube Turning Detail

Start Date: 5/16/2016 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 5/20/2016 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals: Process Plan: MCS Date: MAY 06 2016

Tooling:

Date: _____

Run Start ***NR1***

QC: _____ Date: _____

SPC (Y/N): _____

Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr	Revision Nbr
D119-796-241	<u>H I</u>

100

0.21

100

Mori Seiki

MORI SEIKI CNC LATHE LARGE

Memo

1.96

Mori Seiki CNC Lathe Large

1-Fill tube with sand & install plugs on both ends as per Folio FB298

2-Turn first side as per Folio FB298

3-Blend transition lines only, **do not sand whole tube**:

FOLIO REV: MADWG REV: 5

*Use mill bastard file, brush file repeatedly with file card.

*Do not use sandpaper coarser than 320 grit.

DAS
49
9-89

110

QC2- Inspect parts off machine FAI/FAIB

0.00

110

QC

Memo

0.00

Quality Control

DAS
49
9-89

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :	MRB (QSI042) Approval		
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : ☐					

Work Order ID 145353

Thursday, May 05, 2016 1:41:30 PM

145353

Page 2

Item ID: D119-796-241TRN

Accept

N900040100

Setup Start

NS1

Revision ID:

Stop

NS2

Item Name: Crosstube Turning Detail

Start Date: 5/16/2016 Start Qty: 1.00

1

Cust Item ID:

Required Date: 5/20/2016 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start

NR1

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop

NR2

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
120	MORI SEIKI CNC LATHE LARGE	0.00				1	0		VHJ 6/6/16
120									
Mori Seiki	Memo	2.88							
Mori Seiki CNC Lathe Large	1-Turn second side as per Folio FB298								
	2-Blend transition lines only, **do not sand whole tube**: *Use mill bastard file, brush file repeatedly with file card. *Do not use sandpaper coarser than 320 grit. FOLIO REV: <u>MA</u> DWG REV: <u>I</u> 3-Remove sand and plugs								
	4- scribe batch # and part # as per dwg								
130	QC2- Inspect parts off machine FAI/FAIB	0.00				1	0		VHJ 6/6/16
130									
QC	Memo	0.00							
Quality Control									

DAS
49
9-89

DAS
49
9-89DAS
49
9-89

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause				FAULT CATEGORY					
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐								
Misidentified ☐	Past Due ☐	OTHER : _____							

Work Order ID 145353

Thursday, May 05, 2016 1:41:30 PM

145353

Page 3

Item ID: D119-796-241TRN

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Crosstube Turning Detail

Start Date: 5/16/2016 Start Qty: 1.00

1

Cust Item ID:

Required Date: 5/20/2016 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

140

QC8- Inspect parts - second check

0.00

140

QC

Memo

0.02

Quality Control

1	0		
---	---	--	--

16-06-07

145

0.00

145

Crosstubes

Memo

0.82

Crosstubes

GRIND ONLY TRANSITION LINES SMOOTH LONGITUDE WAY.

16-06-15

150

0.11

150

HandFXtube

Memo

0.69

Hand Finishing Crosstubes

1- PRESSURE WASH X-TUBE INSIDE AND OUT

2- ALODINE AND ACID ETCH X-TUBE INSIDE AND OUT. USE RED
SCOTCH BRITE

16-06-20

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐								
Misidentified ☐	Past Due ☐	OTHER : ☐							

Work Order ID 145353

Thursday, May 05, 2016 1:41:30 PM

145353

Page 4

Item ID: D119-796-241TRN

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Crosstube Turning Detail

Start Date: 5/16/2016 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 5/20/2016 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

160

QC7-Inspect Chemical Conversion Coat

0.00

160

QC

Memo

0.02

Quality Control

16-6-20 DAS 19 98

170

Packaging

0.00

170

Packaging

Memo

0.00

Packaging

LOCATION : LG014

DP 16-6-20

180

QC21- Final Inspection - Work Order Release

0.00

180

QC

Memo

0.10

Quality Control

16/6/21 JH

MCS JUN 20 2016

DQA: _____ Date: _____

**WORK ORDER NON-CONFORMANCE / UPDATE**

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval 		
Description Work Order Deviation				Disposition					
							Completed By		
							Lead hand / Supervisor Approval Verification		
							QC / QA Coordinator Approval		

Root Cause				FAULT CATEGORY			
Environment ☐	☐ No Re-verification	☐ Pressure/Forced	☐ Temperature/Cure	☐ Power Loss/Surge	☐ Positioned Wrong		
Design ☐	☐ Operator	☐ Bending	☐ Set-up	☐ Folio/Program	☐ Outside Dimensions		
Doc/Data ☐	☐ Offset/Setup	☐ Centre Not Concentric	☐ BOM/Route	☐ Grain	☐ Over/Under tolerance		
Equip/Tooling ☐	☐ Supplier	☐ Cracks	☐ Broken/Damage/Defect	☐ Weld	☐ Part Incorrect		
Handling/Pre ☐	☐ Training	☐ Crimp/Kink/Ripple/Wave	☐ Inspection Incomplete/Unqualified	☐ Wrong Stock Pulled	☐ Part Lost/Missing		
Material ☐	☐ Use for Testing	☐ Cuffs	☐ Contamination	☐ Out of Sequence	☐ Part Moved		
Internal Transport ☐	☐ Poor Information	☐ Crushing	☐ Countersink	☐ Off-set	☐ Drawing		
Tribal Knowledge ☐	☐ Rushing	☐ Heat Treat	☐ Cut Too Short	☐ Mislabeled	☐ Finish		
LOA ☐	☐ Product Improvement	☐ Wave/Twist in Tube	☐ Instructions Incomplete/Unclear	☐ Fit/Function	☐ Misread		
Substation ☐	☐ Process Improvement	☐ Marks/Chatter	☐ Drill Holes	☐ Misaligned/off center	☐ Turning Sequence		
Past Expiry Date ☐	☐ Manufacturing Process	OTHER :					
Misidentified ☐	☐ Past Due						

Picklist Print

Thursday, May 05, 2016 1:41:33 PM

Page 1

Work Order ID: 145353

145353

Parent Item: D119-796-241TRN

D119-796-241TRN

Parent Item Name: Crosstube Turning Detail

Start Date: 5/16/2016

Required Date: 5/20/2016

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP REV A RQ 14/05/27 VERIFIED BY DD
16.05.04 AS PER DWG REV.I DD VERF:JLM

IPP REV:B

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D6023-106		Manufactured	No			100	Each	24.0000	1	1			

D6023-106

Crosstube Material

Location

Loc Qty

Loc Code

LG003

24

139411

24

VHS 16/5/31

D/DAS
4-49
9-88-8

DQA: _____ Date: _____

**WORK ORDER NON-CONFORMANCE / UPDATE**

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :				MRB (QSI042) Approval 	
Description Work Order Deviation				Disposition					
								Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	

Root Cause			FAULT CATEGORY		
Environment ☐	☐ No Re-verification	☐ Pressure/Forced	☐ Temperature/Cure	☐ Power Loss/Surge	☐ Positioned Wrong
Design ☐	☐ Operator	☐ Bending	☐ Set-up	☐ Folio/Program	☐ Outside Dimensions
Doc/Data ☐	☐ Offset/Setup	☐ Centre Not Concentric	☐ BOM/Route	☐ Grain	☐ Over/Under tolerance
Equip/Tooling ☐	☐ Supplier	☐ Cracks	☐ Broken/Damage/Defect	☐ Weld	☐ Part Incorrect
Handling/Pre ☐	☐ Training	☐ Crimp/Kink/Ripple/Wave	☐ Inspection Incomplete/Unqualified	☐ Wrong Stock Pulled	☐ Part Lost/Missing
Material ☐	☐ Use for Testing	☐ Cuffs	☐ Contamination	☐ Out of Sequence	☐ Part Moved
Internal Transport ☐	☐ Poor Information	☐ Crushing	☐ Countersink	☐ Off-set	☐ Drawing
Tribal Knowledge ☐	☐ Rushing	☐ Heat Treat	☐ Cut Too Short	☐ Mislabeled	☐ Finish
LOA ☐	☐ Product Improvement	☐ Wave/Twist in Tube	☐ Instructions Incomplete/Unclear	☐ Fit/Function	☐ Misread
Substation ☐	☐ Process Improvement	☐ Marks/Chatter	☐ Drill Holes	☐ Misaligned/off center	☐ Turning Sequence
Past Expiry Date ☐	☐ Manufacturing Process	OTHER : _____			
Misidentified ☐	☐ Past Due				


DART AEROSPACE LTD		Work Order: 145353
Description: Crosstube Assembly (AW119 MKII Aft)		Part Number: D119-796-241TRN
Inspection Dwg: D119-796-241 Rev: <i>H I M</i>		Page 1 of 2

FIRST ARTICLE INSPECTION CHECKLIST

Inspection Sheet Drawing Dimension		Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A	5.88	+/-0.030	5.88	✓			
	2.516	+0.005/-0.000	2.520	✓			
	2.626	+0.005/-0.000	2.630	✓			
	2.627	+0.005/-0.000	2.631	✓			
	2.798	+0.005/-0.000	2.8015	✓			
	2.799	+0.005/-0.000	2.804	✓			
	2.989	+0.005/-0.000	2.995	✓			
	3.191	+0.005/-0.000	3.190	✓			
	3.200	+0.005/-0.000	3.200	✓			
SIDE B	5.88	+/-0.030	5.88	✓			
	2.516	+0.005/-0.000	2.521	✓			
	2.626	+0.005/-0.000	2.632	✓			
	2.627	+0.005/-0.000	2.632	✓			
	2.798	+0.005/-0.000	2.802	✓			
	2.799	+0.005/-0.000	2.804	✓			
	2.989	+0.005/-0.000	2.994	✓			
	3.191	+0.005/-0.000	3.190	✓			
	3.200	+0.005/-0.000	3.200	✓			
	105.71	+/-0.020	105.71				

DART AEROSPACE LTD	Work Order: 145353
Description: Crosstube Assembly	Part Number: 119-796-241 TRN
Inspection Dwg: 0119-796-241 Rev: I	Page 2 of 2

WALL THICKNESS MEASUREMENT

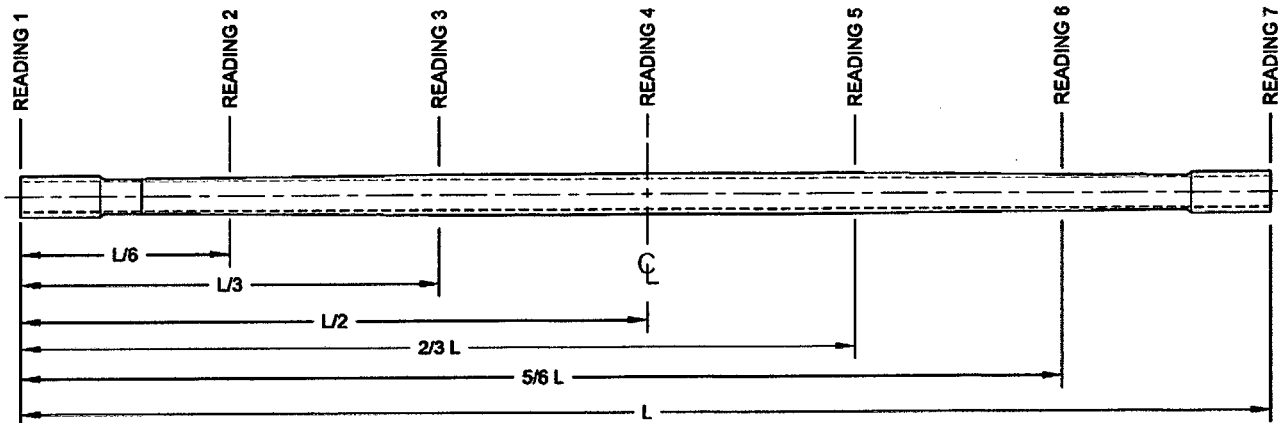

Location	WALL THICKNESS MEASUREMENT (IN)				Deviation Δw (max-min)	TOLERANCE
	w1	w2	w3	w4		
READING 1 L = 0"	.154	.134	.129	.146	0.025	0.030
READING 2 L = 17.68	.238	.207	.198	.225	< 0.040 >	
READING 3 L = 35.236	.336	.317	.302	.322	0.034	0.063
READING 4 L = 52.844	.497	.477	.467	.486	0.030	
READING 5 L = 70.462	.322	.317	.315	.322	0.007	
READING 6 L = 88.08	.222	.218	.210	.218	0.012	0.030
READING 7 L = 105.71	.149	.139	.137	.142	0.012	

Dwg 4

0.257 0.009

DAS
12
9-89

4/14/97

DAS
49
9-89

Calibration Result


Actual Block Thickness: 100-500

Sitescan 250 Measured Thickness: 100-500

DAS
47
9-89

Measured by: <i>[Signature]</i>	Audited by: <i>[Signature]</i>	Preliminary Approval:
Date: 10/16/06	Date: 16-06-07	Date:

Rev	Date	Change	Revised by	Approved
B	10.04.14	Added preliminary approval	KJ	
C	12.06.01	Wall thickness form added	KJ	

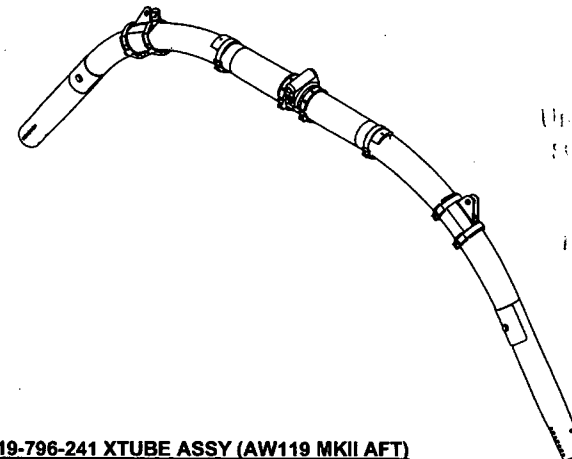

WORK COPY
 RETURN TO
 ENGINEERING
 UNCONTROLLED COPY
 SUBJECT TO AMENDMENT
 WITHOUT NOTICE
 WORK ORDER
 NO 145353 MWS

1605-06

D119-796-241 XTUBE ASSY (AW119 MKII AFT)

NOTES:


- 1) MATERIAL: N/A
- 2) FINISH: APPLY MATTE CLEAR COAT PER QSI 005 4.2
 MASK D5134-041/-042 DAMPER SUPPORT ASSEMBLIES, D5136-1/-2 CONTACT PADS AS WELL AS
 UNDERSIDE OF CROSSTUBE AS SHOWN (B4-2, HATCHED AREA),
 PAINT OUTSIDE PER DART QSI 005 4.2 AFTER APPLYING CLEAR COAT
 DO NOT APPLY FINISH (PAINT OR CLEAR COAT) TO CUFFS IN LOCATION SHOWN, MASK PRIOR TO FINISHING
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: N/A
- 6) IDENTIFICATION: IDENTIFY USING PART NUMBER "D119-796-241" AND BATCH NUMBER
 ON INSIDE OF CUFF PER QSI 044 6.4
- 7) WEIGHT: 26.26 lbs
- 8) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE.
 THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM DEFECTS SUCH AS
 SCRATCHES, NICKS OR DENTS. DEFECTS UP TO 0.005 MAY BE BLENDED OUT
 LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 9) INSTALL D5122-1 CENTER SUPPORT HAND TIGHT ONLY. DO NOT TORQUE. INSTALL RED
 TAG TO INDICATE "D5122-1 CENTER SUPPORT MUST BE BONDED PER IIN-D119-796 PRIOR TO FLIGHT".
- 10) PRIOR TO FINISHING, ABRASE MATING SURFACES OF D5136-1/-2 AND SURFACE OF
 CROSSTUBE WITH SCOTCH BRITE 7447 RED AND REMOVE RESIDUE WITH DUPONT
 4105S WASH 'N' WIPE DEGREASER. APPLY A 0.100" MIN THK LAYER OF PROSEAL 890
 ON THE INSIDE CONCAVE SURFACE OF THE D5136-1/-2 CONTACT PADS AND INSTALL
 AT AN 8.4° OFFSET FROM THE CROSSTUBE BENDING PLANE. INSTALL MS21920-25
 CLAMPS AND D5123-5 CLAMP CUSHIONS WHILE WET. PRIOR TO PACKAGING, RE-CHECK
 TORQUE ON CLAMPS AFTER PROSEAL 890 SEALANT HAS CURED FOR 72 HOURS.
- 11) TORQUE MS21920 CLAMPS 80 - 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN
 SAFETY, THE NUT HAS NOT BOTTOMED-OUT AFTER TORQUING AND THE NUT IS FACING AFT.
- 12) PRIOR TO FINISHING, POSITION AND INSTALL D5134-041/-042 DAMPER SUPPORTS USING JIG DT10085.
 ABRASE MATING SURFACES OF THE D5134-041/-042 DAMPER SUPPORTS AND CROSSTUBE WITH
 SCOTCH BRITE 7447 RED AND REMOVE RESIDUE WITH DUPONT 4105S WASH 'N' WIPE
 DEGREASER. APPLY A 0.100" MIN THK LAYER OF PROSEAL 890 ON THE INSIDE CONCAVE SURFACE
 OF THE D5134-041/-042. INSTALL MS21920-25 CLAMPS AND D5123-1 CLAMP CUSHIONS WHILE WET.
 PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER PROSEAL 890 SEALANT HAS CURED
 FOR 72 HOURS.
- 13) PRIOR TO FINISHING, ABRASE MATING SURFACES OF CROSSTUBE AND D5152-043 WITH
 SCOTCH BRITE 7447 RED AND REMOVE RESIDUE WITH DUPONT 4105S WASH 'N' WIPE DEGREASER.
 INSTALL D5152-043 WITH LAYER OF PROSEAL 890 ON INSIDE CONCAVE SURFACE, 0.100" MIN THK
 LOCATE D5152-043 USING TOOL DT10112.

I	D6023-106 MATERIAL REPLACES D8009-106, D5136-1/-2 & D5134-041/-042 NOW INSTALLED ON PRIMER.	AP	15.10.13
H	NOTE 9 RE-WRITTEN. BONDING INSTRUCTIONS MOVED TO IIN. SEE PREVIOUS REV FOR DETAILS.	AP	15.07.02
G	FINISHING ORDER ADJUSTED, UPDATE BEND TOLERANCE AND TRN DETAIL TOLERANCE TO MATCH D119-796-141 DWG	AP	15.04.24
F	REMOVED PRIMER/PAINT ON CUFFS, 2.516 WAS 2.500 (C8-5)	AP	15.02.03
E	D5152-043 WAS D5150-3, SCOTCH BRITE 7447 RED WAS 180 GRIT SANDPAPER	DB	15.01.15
D	ADD D5150-3 STEP POST (2X), MOVED INSPECTION WINDOW DETAIL TO SHT 1, MODIFIED NOTES ON SH 1 & 3	DB	14.11.25
C	CR3212-4-07 RIVETS WAS CR3212-4-05 RIVETS, RADIUS BLOCK WAS NUT PLATE ASSEMBLY (BOM), REMOVED 7.5 DEG CUFF HOLE OFFSET (A1-3), REDUCED CUFF DIA TO 2.500 (C8-5), ADD INSPECTION WINDOW	AP	14.10.23
B	ORIENTATION OF D5122-1 CENTER SUPPORT WAS CORRECTED. D5123-5 ADDED UNDER D5136-1/-2 CONTACT PADS. ADDED D2873-043 NUT PLATE ASSY & CR3212-4-05 RIVETS. ADDED REFERENCE TO SKIDTUBES FOR LOCATING CUFF HOLES. RE-ORGANIZED NOTES, REMOVED REDUNDANT INFORMATION.	AP	14.09.08
A	NEW ISSUE	AP	14.08.07
REV.	DESCRIPTION	BY	DATE
DESIGN	AP	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	AP		
CHECKED	AJS	DRAWING NO.	REV. 1
MFG. APPR.	JLM	D119-796-241	SHEET 1 OF 7
APPROVED	WM	TITLE	SCALE
DE APPR.	DS	XTUBE ASSY (AW119 MKII AFT)	NTS
DATE	15.10.13	COPYRIGHT © 2014 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

RELEASED
 2015-11-04
 EW 15-642

APPROVED

ITEM	QTY	P/N	DESCRIPTION
	X	D119-796-241	XTUBE ASSY (AW119 MKII AFT)
1	1	D119-796-241BND	CROSSTUBE, AFT
2	4	D2873-043	RADIUS BLOCK
3	1	D5122-1	CENTER SUPPORT
4	6	D5123-1	CLAMP CUSHION
5	2	D5123-5	CLAMP CUSHION
6	1	D5134-041	DAMPER SUPPORT ASSY, LH
7	1	D5134-042	DAMPER SUPPORT ASSY, RH
8	1	D5136-1	CONTACT PAD, LH
9	1	D5136-2	CONTACT PAD, RH
10	2	D5152-043	AFT POST MOUNT ASSY
11	16	CR3212-4-07	RIVET, BLIND CSK
12	6	MS21920-25	CLAMP
13	2	MS21920-28	CLAMP

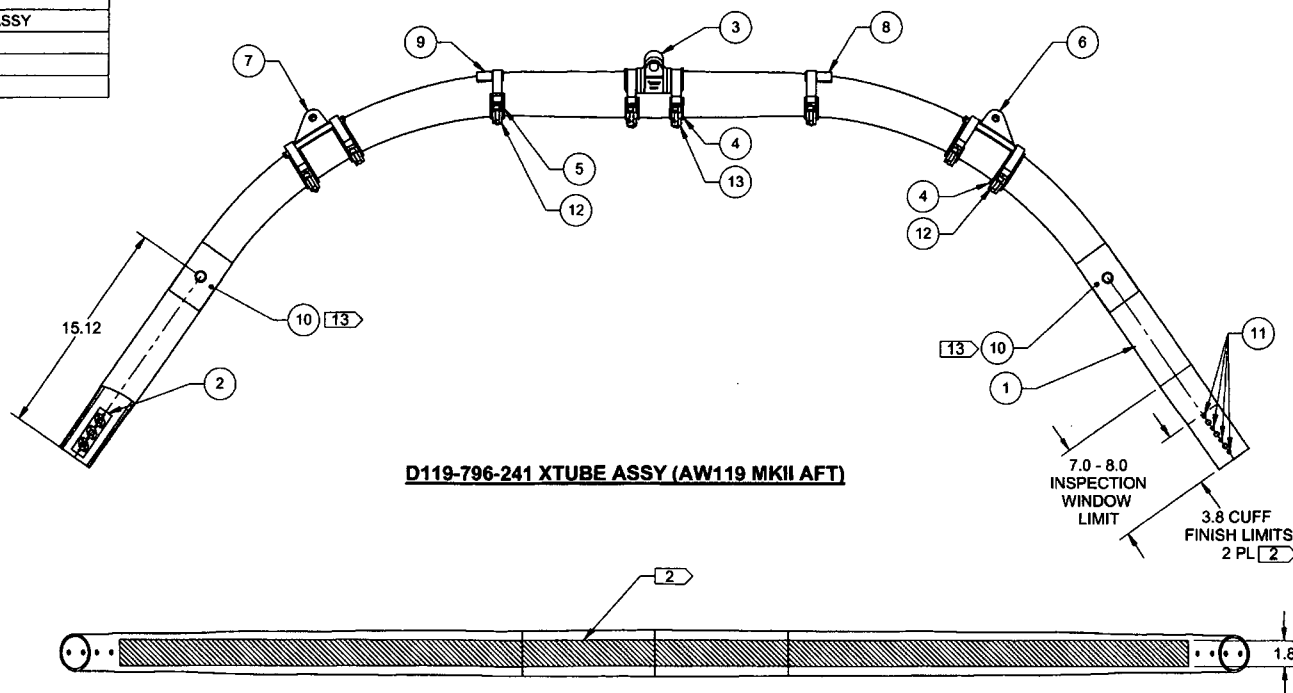


D119-796-241 XTUBE ASSY (AW119 MKII AFT)


RELEASED
2015-11-04

APPROVED

DESIGN	AP	DART AEROSPACE LTD	
DRAWN	AP	HAWKESBURY, ONTARIO, CANADA	
CHECKED	AJS	DRAWING NO.	REV. 1
MFG. APPR.	JLM	D119-796-241	SHEET 2 OF 7
APPROVED	WM	TITLE	SCALE
DE APPR.	DS	XTUBE ASSY (AW119 MKII AFT)	NTS
DATE	15.10.13	COPYRIGHT © 2014 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

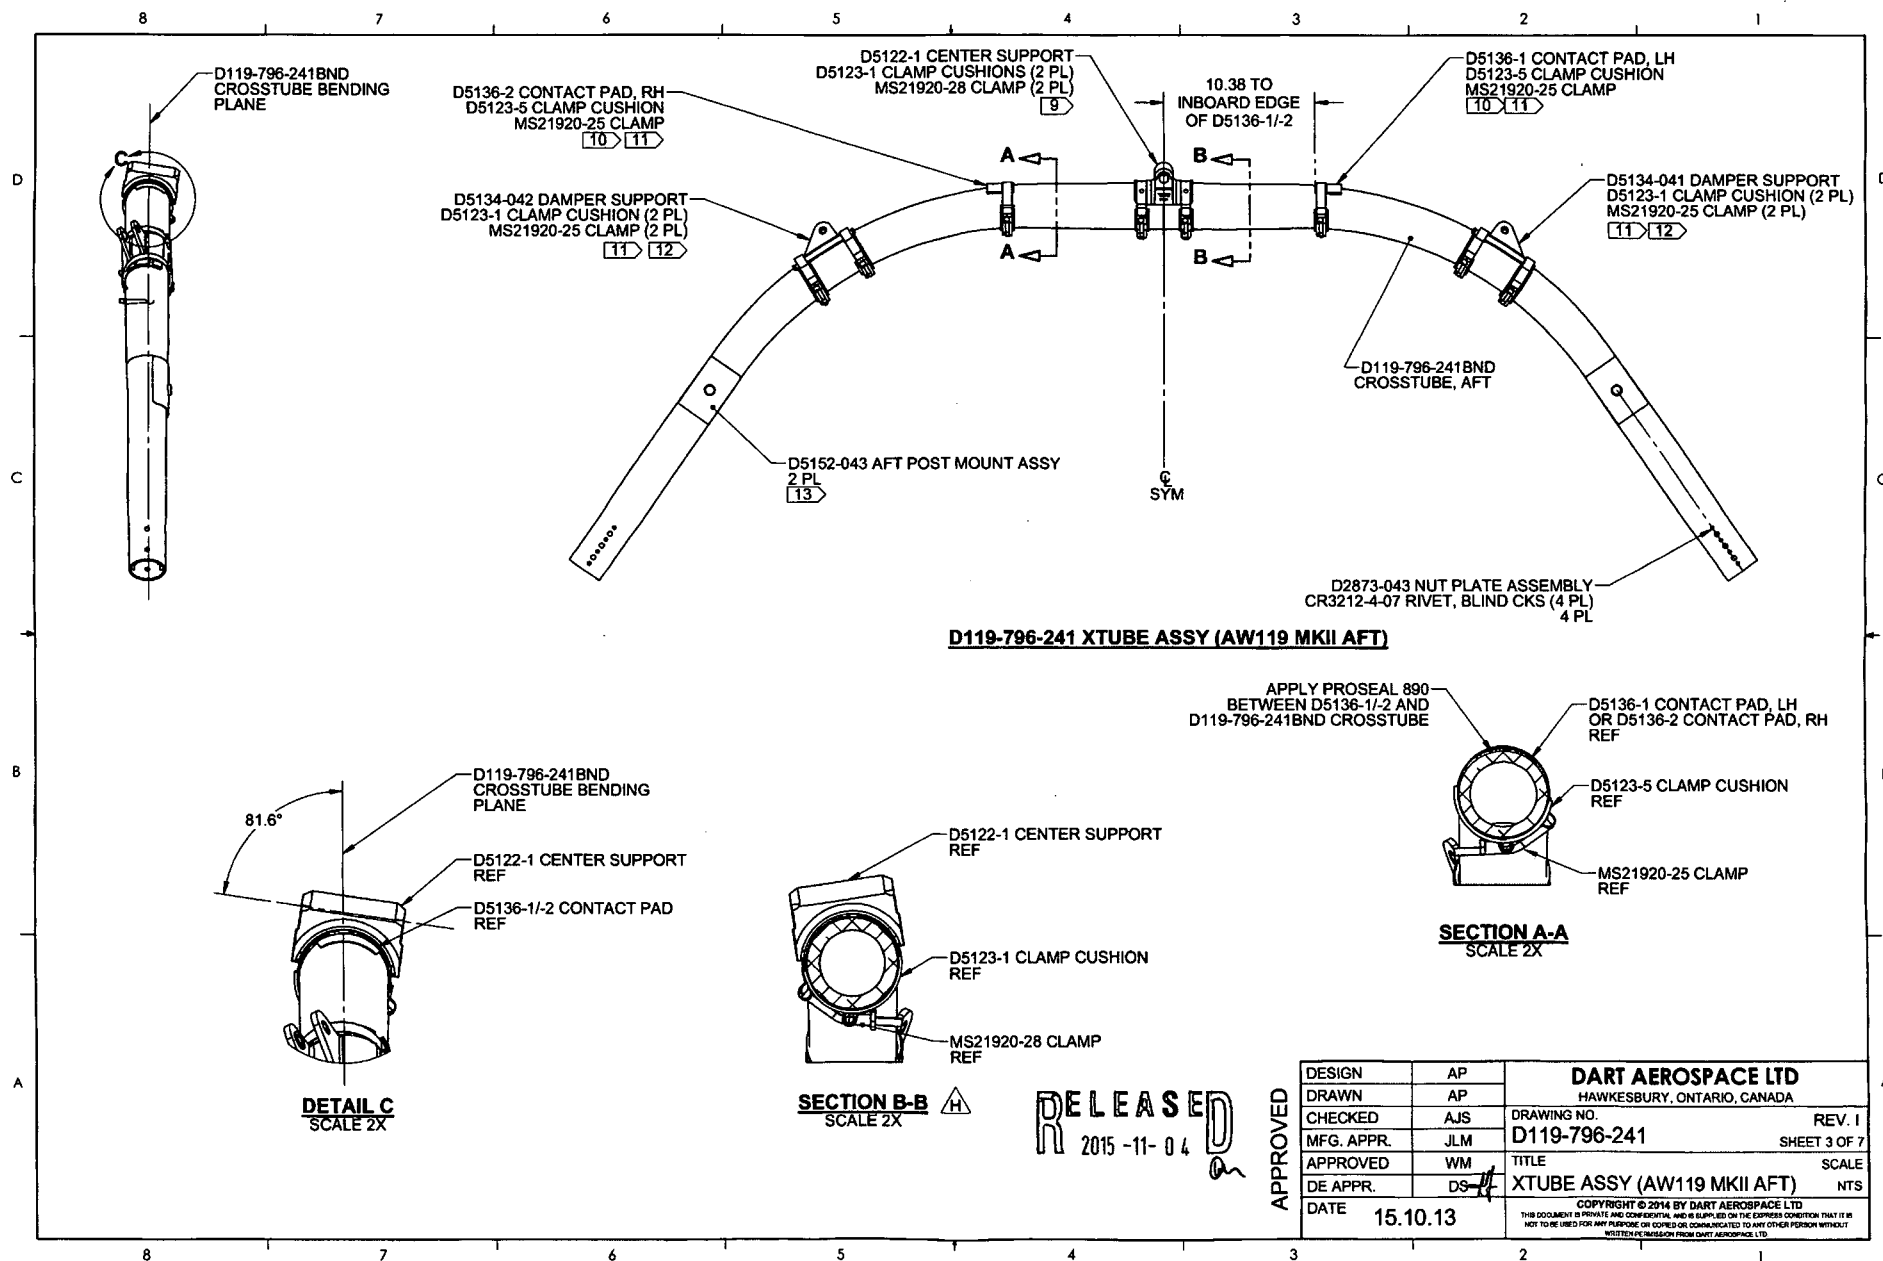



DESIGN	AP	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	AP		
CHECKED	AJS	DRAWING NO.	REV. 1
MFG. APPR.	JLM	D119-796-241	SHEET 3 OF 7
APPROVED	WM	TITLE	SCALE
DE APPR.	DS	XTUBE ASSY (AW119 MKII AFT)	NTS
DATE	15.10.13	COPYRIGHT © 2014 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

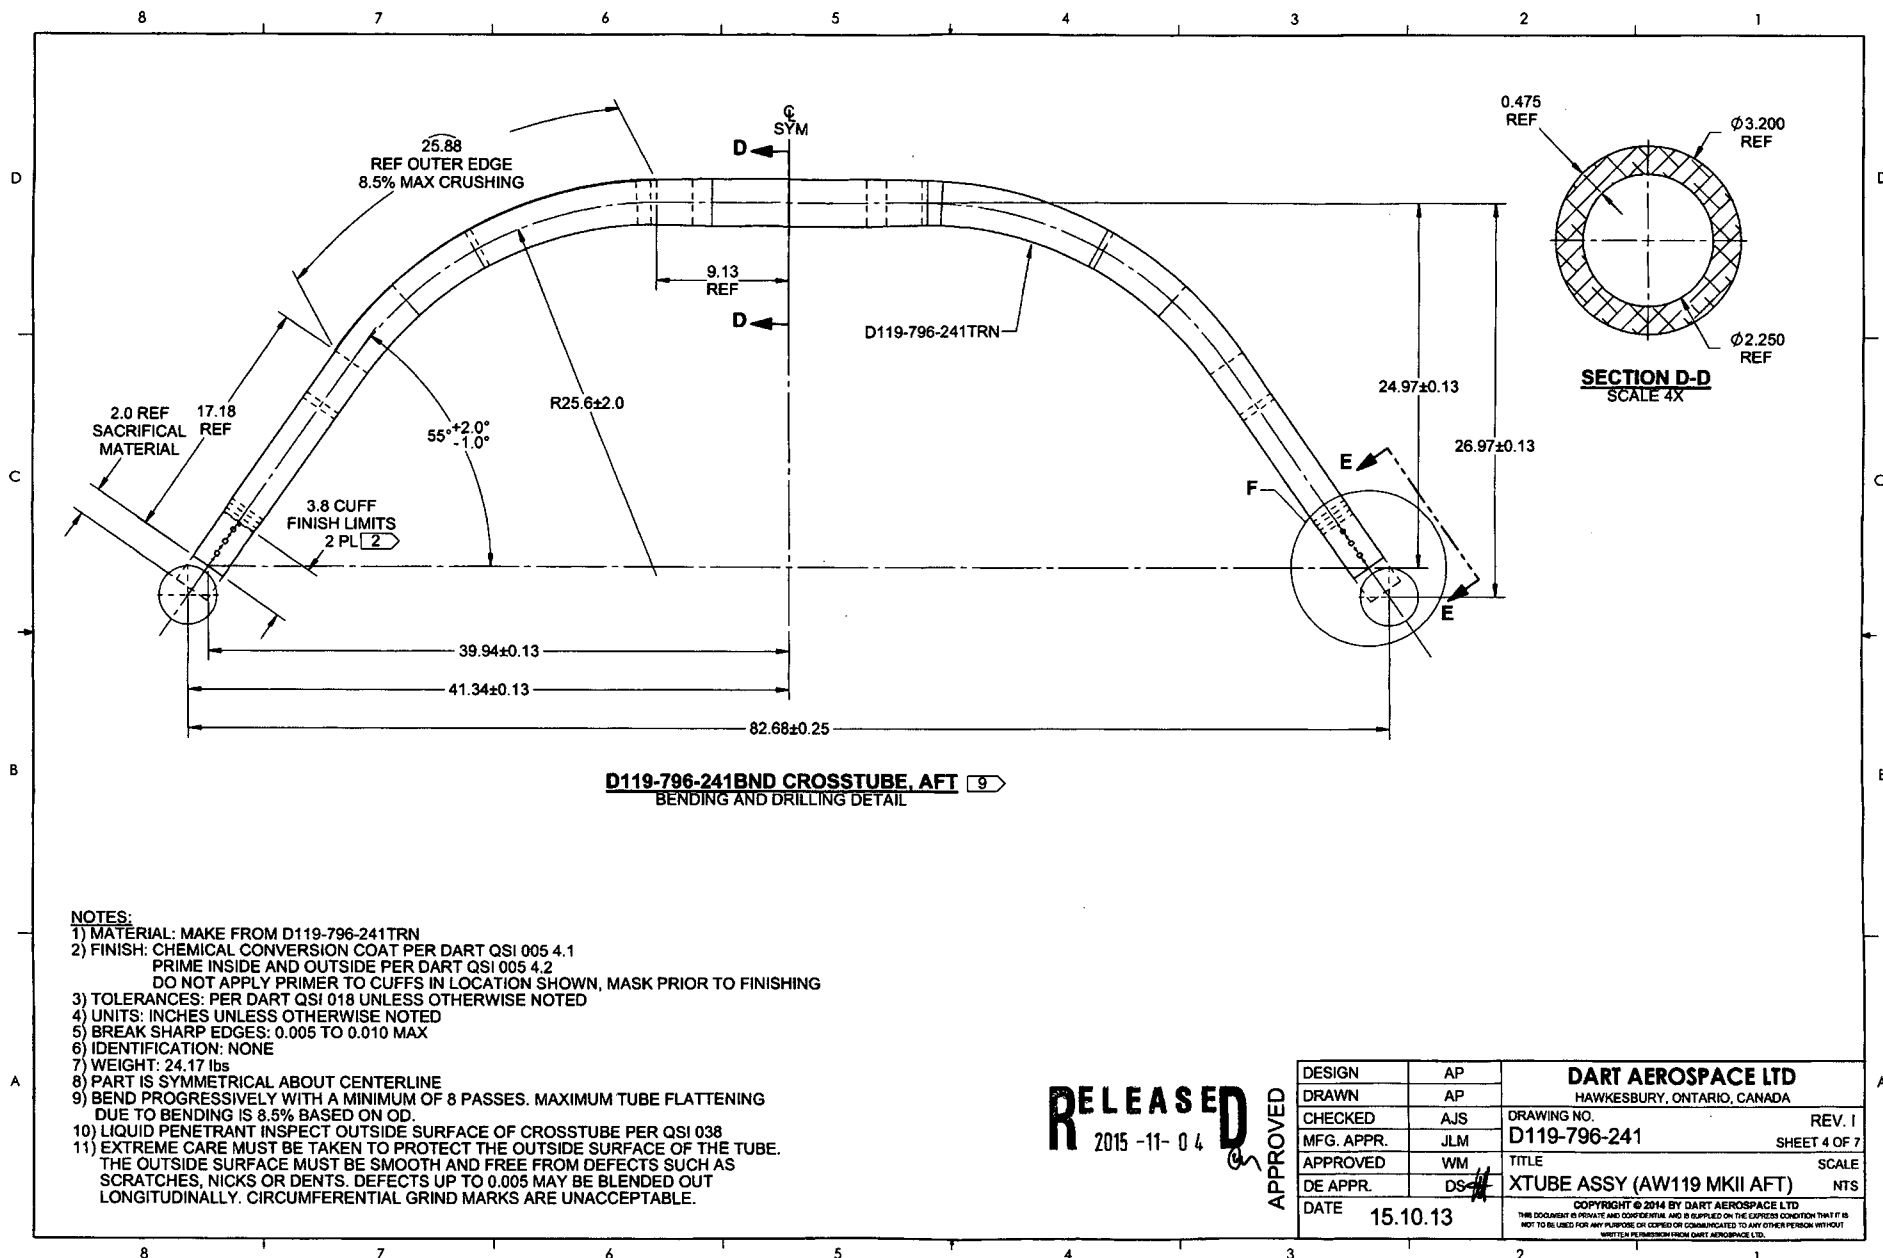

RELEASED
2015-11-04

APPROVED


DESIGN	AP	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	AP		
CHECKED	AJS	DRAWING NO.	REV. I
MFG. APPR.	JLM	D119-796-241	SHEET 4 OF 7
APPROVED	WM	TITLE	SCALE
DE APPR.	DS	XTUBE ASSY (AW119 MKII AFT)	NTS
DATE	15.10.13	COPYRIGHT © 2014 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

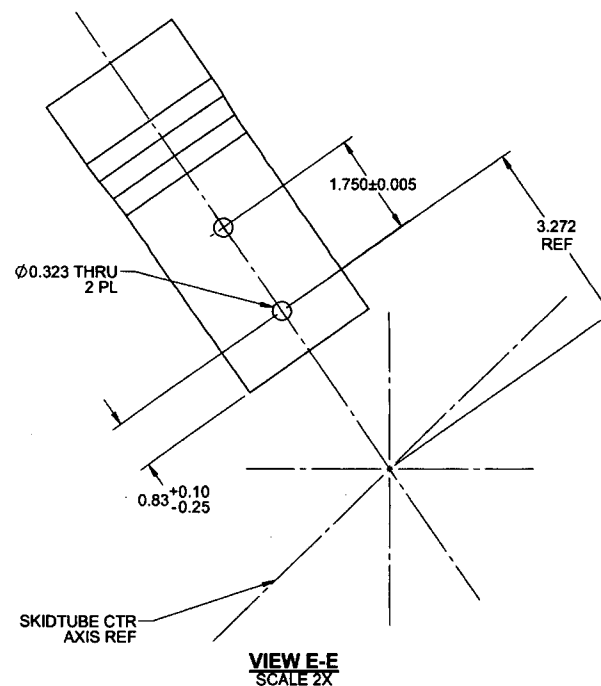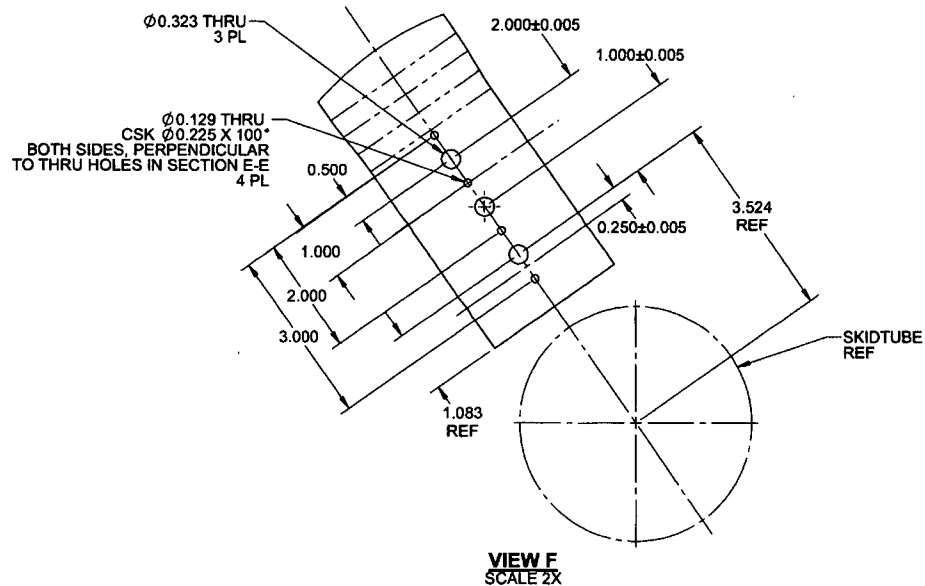

RELEASED
2015-11-04


APPROVED

DESIGN	AP	DART AEROSPACE USA, INC.	
DRAWN	AP	KENT, WA	
CHECKED	AJS	DRAWING NO.	REV. I
MFG. APPR.	JLM	D119-796-241	SHEET 5 OF 7
APPROVED	WM	TITLE	SCALE
DE APPR.	DS	XTUBE ASSY (AW119 MKII AFT)	NTS
DATE	15.10.13	COPYRIGHT © 2014 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

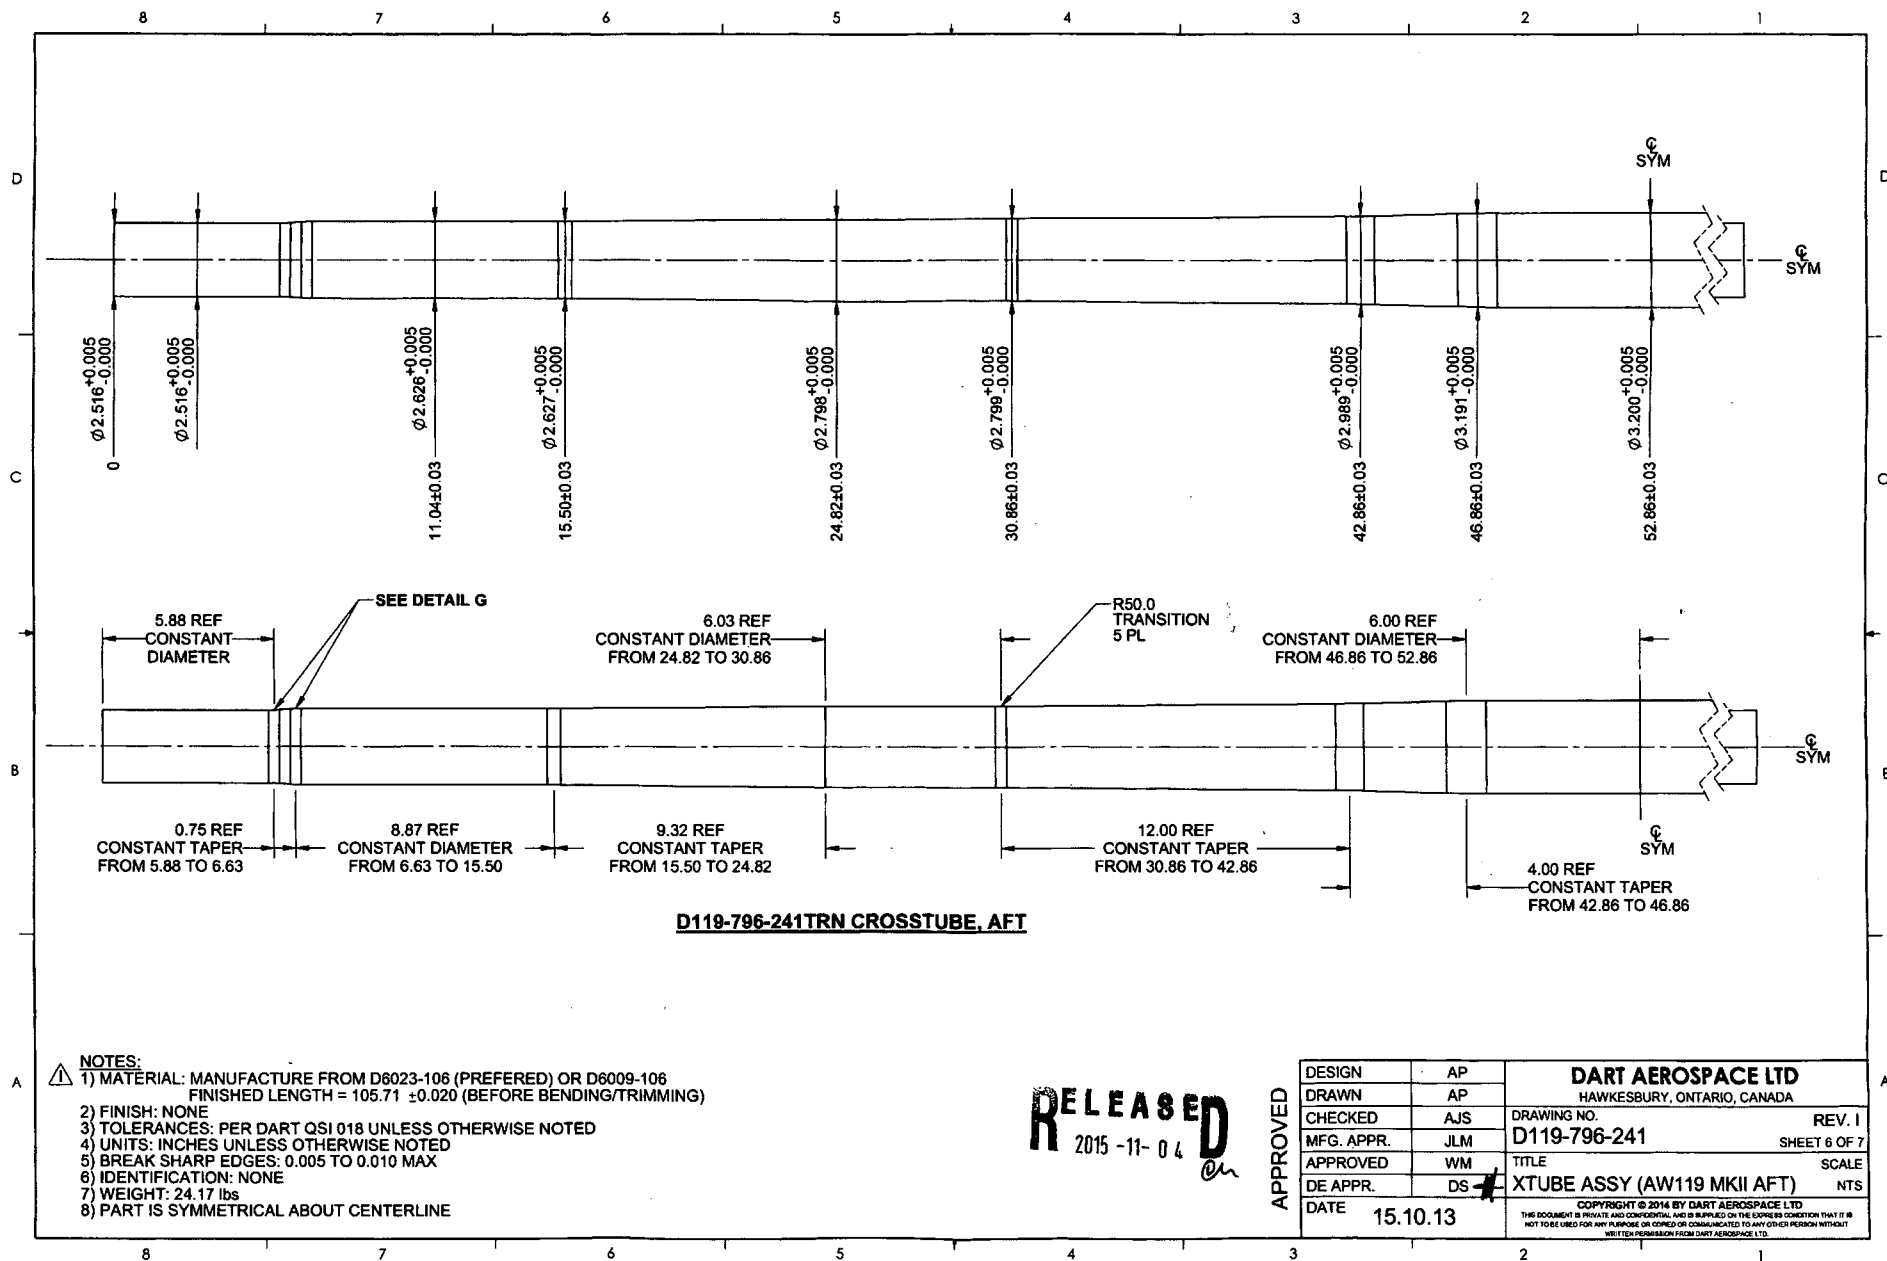


CHAMFER AS
REQUIRED FOR
TOOLING

DETAIL H
SCALE 4X

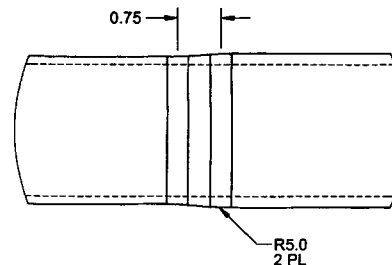

DETAIL G
SCALE 2X

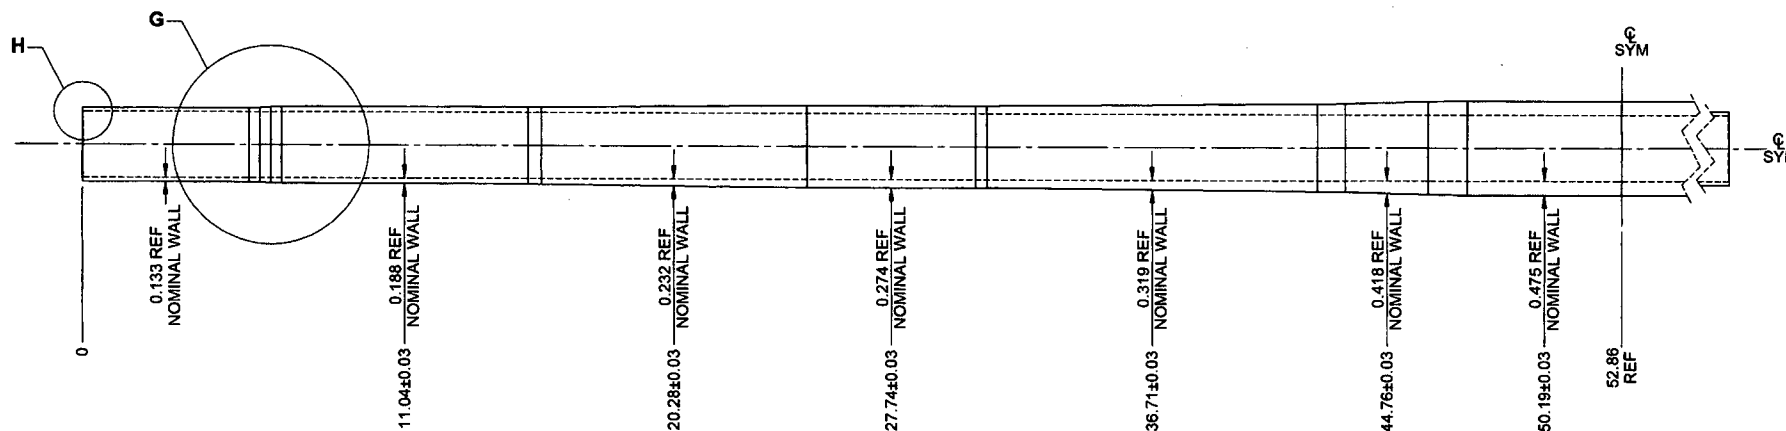

D119-796-241 TRN CROSSTUBE AFT
SUPPLEMENTAL VIEW: NOMINAL WALL THICKNESS

RELEASED
2015-11-04

APPROVED

DESIGN	AP	DART AEROSPACE LTD	
DRAWN	AP	HAWKESBURY, ONTARIO, CANADA	
CHECKED	AJS	DRAWING NO.	REV. 1
MFG. APPR.	JLM	D119-796-241	SHEET 7 OF 7
APPROVED	WM	TITLE	SCALE
DE APPR.	DS	XTUBE ASSY (AW119 MKII AFT)	NTS
DATE	15.10.13	COPYRIGHT © 2014 BY DART AEROSPACE LTD THIS DOCUMENT IS PROPRIETARY AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	